



South Coast AQMD Site Survey Report for Central San Bernardino Mountains

Last updated: May 10, 2021

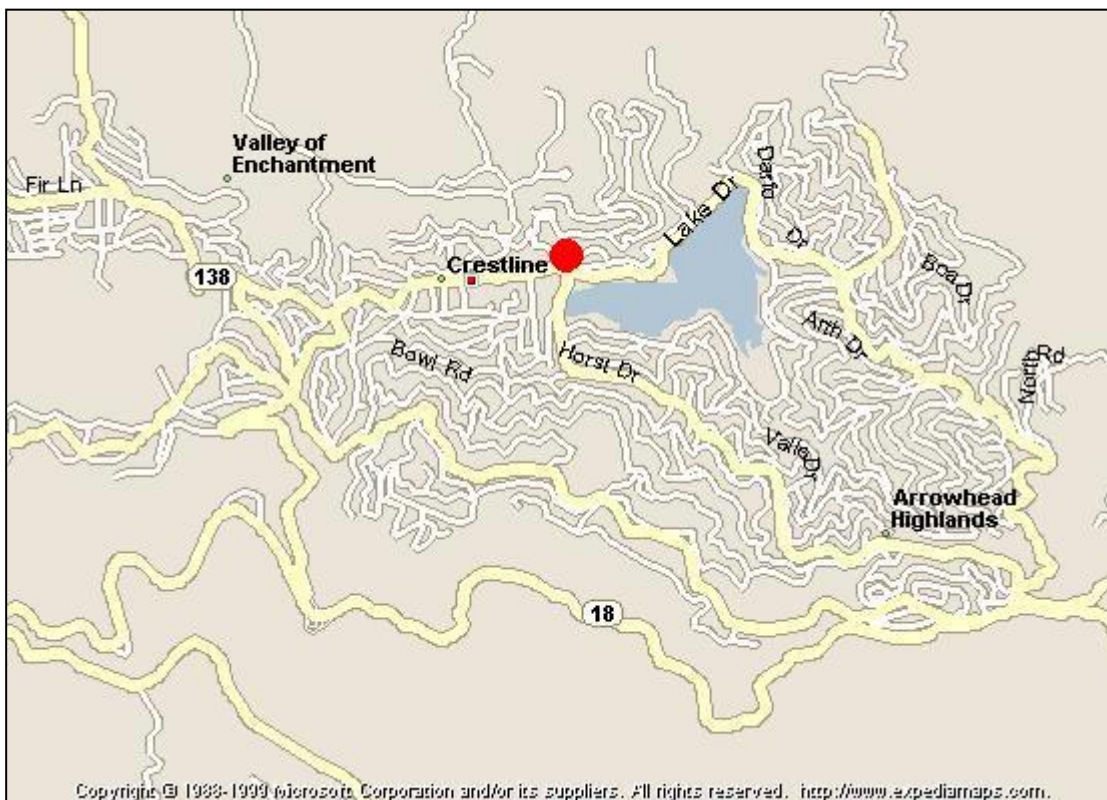

AQS ID	ARB Number	Site Start Date	Reporting Agency and Agency Code
060710005	36181	10/1973	South Coast AQMD (0972)

Site Address	County	Air Basin	Latitude	Longitude	Elevation
24171 Lake Drive Crestline, CA 92325	San Bernardino	South Coast	34° 14' 35"N	117° 16' 20"W	1387

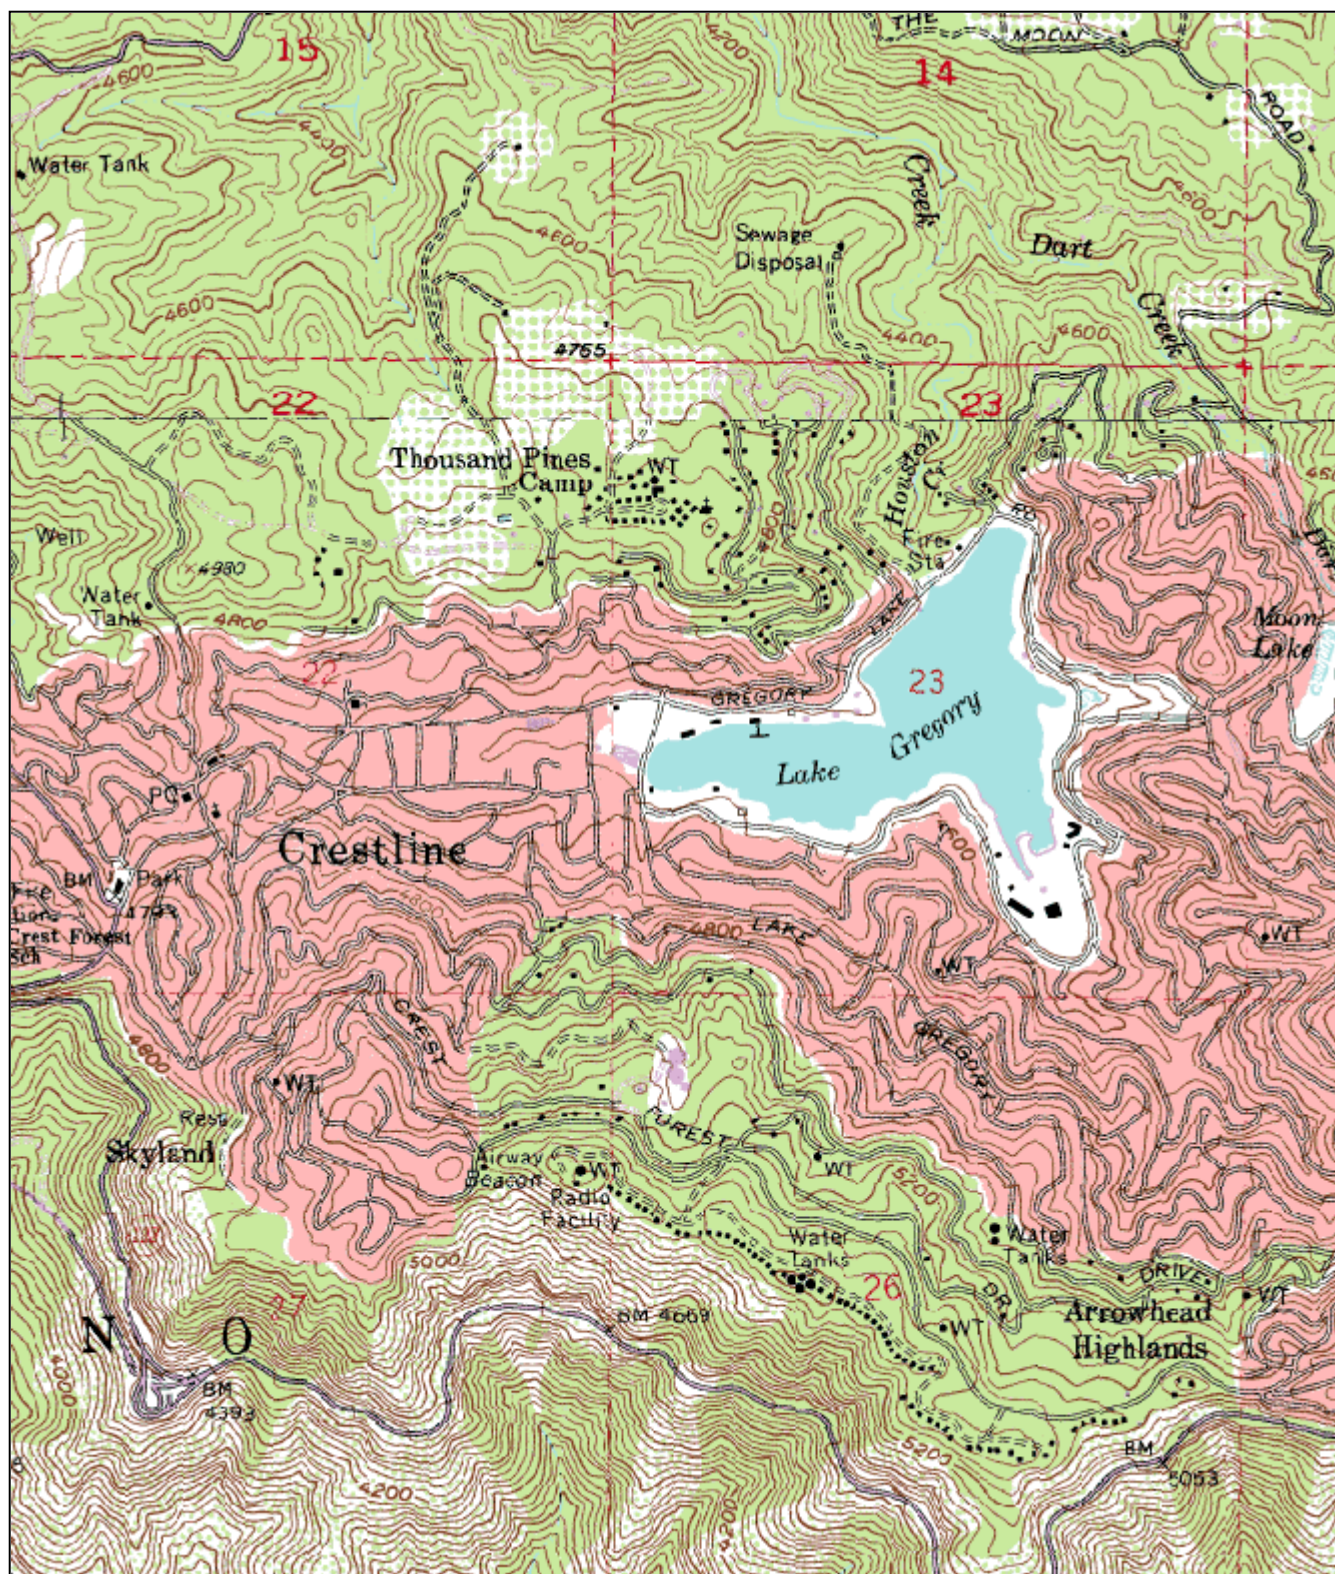

Detailed Site Information

Local site name	Central San Bernardino Mountains			
AQS ID	060710005			
GPS coordinates (decimal degrees)	Latitude: 34° 14' 35" Longitude: 117° 16' 20"			
Street Address	24171 Lake Drive, Crestline, CA 92325			
County	San Bernardino			
Distance to roadways (meters)	55			
Traffic count (AADT, year)	< 8,000 / 2012			
Groundcover (e.g. asphalt, dirt, sand)	Grass/Weeds			
Representative statistical area name (i.e. MSA, CBSA, other)	40140-Riverside-San Bernardino-Ontario, CA MSA			
Pollutant, POC	Ozone, 1	PM10, 1	Continuous PM2.5, 3	
Primary / QA Collocated / Other	N/A	Primary	Other	
Parameter code	44201	81102	88502	
Basic monitoring objective(s)	NAAQS	NAAQS	NAAQS	
Site type(s)	Highest Concentration	Population Exposure	Population Exposure	
Monitor (type)	SLAMS	SLAMS	SLAMS	
Network Affiliation	N/A	N/A	N/A	
Instrument manufacturer and model	Thermo 49i	Sierra Andersen 1200 SSI	Met One BAM 1020	
Method code	047	063	731	
FRM/FEM/ARM/ other	FEM	FRM	Non-FEM	
Collecting Agency	South Coast AQMD	South Coast AQMD	South Coast AQMD	
Analytical Lab (i.e., weigh lab, toxics lab, other)	N/A	South Coast AQMD	N/A	
Reporting Agency	South Coast AQMD	South Coast AQMD	South Coast AQMD	
Spatial scale (e.g. micro, neighborhood)	Neighborhood	Neighborhood	Neighborhood	
Monitoring start date (MM/DD/YYYY)	10/01/1973	01/1985	07/24/2009	
Current sampling frequency (e.g. 1:3, continuous)	1:1	1:6	1:1	
Calculated sampling frequency (e.g. 1:3/1:1)	N/A	1:6	N/A	
Sampling season (MM/DD-MM/DD)	01/01-12/31	01/01-12/31	01/01-12/31	
Probe height (meters)	3.0	4.0	4.5	
Distance from supporting structure (meters)	2.0	2.0	2.0	
Distance from obstructions on roof (meters)	N/A	N/A	N/A	

Distance from obstructions not on roof (meters)	N/A	N/A	N/A	
Distance from trees (meters)	10	10	10	
Distance to furnace or incinerator flue (meters)	N/A	N/A	N/A	
Distance between collocated monitors (meters)	N/A	N/A	N/A	
Unrestricted airflow (degrees)	225°	225°	225°	
Probe material for reactive gases (e.g. Pyrex, stainless steel, Teflon)	Teflon	N/A	N/A	
Residence time for reactive gases (seconds)	12.4	N/A	N/A	
Will there be changes within the next 18 months? (Y/N)	No	No	No	
Is it suitable for comparison against the annual PM2.5? (Y/N)	N/A	N/A	N/A	
Frequency of flow rate verification for manual PM samplers	N/A	Monthly	N/A	
Frequency of flow rate verification for automated PM analyzers	N/A	N/A	Monthly	
Frequency of one-point QC check for gaseous instruments	Nightly	N/A	N/A	
Last Annual Performance Evaluation for gaseous parameters (MM/DD/YYYY)	06/26/2020	N/A	N/A	
Last two semi-annual flow rate audits for PM monitors (MM/DD/YYYY, MM/DD/YYYY)	N/A	08/27/2020 The first of two semi-annual flow rate audits were not completed due to COVID-19.	05/19/2020 12/10/2020	

Pollutant, POC	WS & D, 1/1	RH/T, 1/1		
Primary / QA Collocated / Other	N/A	N/A		
Parameter code	61101/61102	62201/62101		
Basic monitoring objective(s)	NAAQS	NAAQS		
Site type(s)	Meteorological	Meteorological		
Monitor (type)	SLAMS	SLAMS		
Network Affiliation	N/A	N/A		
Instrument manufacturer and model	RM Young 05305V	Rotronic HC2-S3		
Method code	065/065	063/063		
FRM/FEM/ARM/ other	N/A	N/A		
Collecting Agency	South Coast AQMD	South Coast AQMD		
Analytical Lab (i.e., weigh lab, toxics lab, other)	N/A	N/A		
Reporting Agency	South Coast AQMD	South Coast AQMD		
Spatial scale (e.g. micro, neighborhood)	Neighborhood	Neighborhood		
Monitoring start date (MM/DD/YYYY)	10/1973	10/1973		
Current sampling frequency (e.g.1:3, continuous)	Continuous	Continuous		
Calculated sampling frequency (e.g. 1:3/1:1)	1:1	1:1		
Sampling season (MM/DD-MM/DD)	01/01-12/31	01/01-12/31		
Probe height (meters)	10.0	9.0		
Distance from supporting structure (meters)	N/A	N/A		
Distance from obstructions on roof (meters)	N/A	N/A		
Distance from obstructions not on roof (meters)	N/A	N/A		
Distance from trees (meters)	15	10		
Distance to furnace or incinerator flue (meters)	N/A	N/A		
Distance between collocated monitors (meters)	N/A	N/A		
Unrestricted airflow (degrees)	225°	225°		

Probe material for reactive gases (e.g. Pyrex, stainless steel, Teflon)	N/A	N/A		
Residence time for reactive gases (seconds)	N/A	N/A		
Will there be changes within the next 18 months? (Y/N)	No	No		
Is it suitable for comparison against the annual PM _{2.5} ? (Y/N)	N/A	N/A		
Frequency of flow rate verification for manual PM samplers	N/A	N/A		
Frequency of flow rate verification for automated PM analyzers	N/A	N/A		
Frequency of one-point QC check for gaseous instruments	N/A	N/A		
Last Annual Performance Evaluation for gaseous parameters (MM/DD/YYYY)	N/A	N/A		
Last two semi-annual flow rate audits for PM monitors (MM/DD/YYYY, MM/DD/YYYY)	N/A	N/A		

**Central San Bernardino Mountains
Site Photos**



Looking North from the probe.



Looking East from the probe.



Looking South from the probe.



Looking West from the probe.

**Central San Bernardino Mountains
Site Photos (Cont.)**



Looking at the probe from the North.



Looking at the probe from the East.



Looking at the probe from the South



Looking at the probe from the West.